



Important information concerning connection of the Model 150 and Model 250 credit card readers to the telephone network.

Connect your Model 150 to the telephone network as shown below:

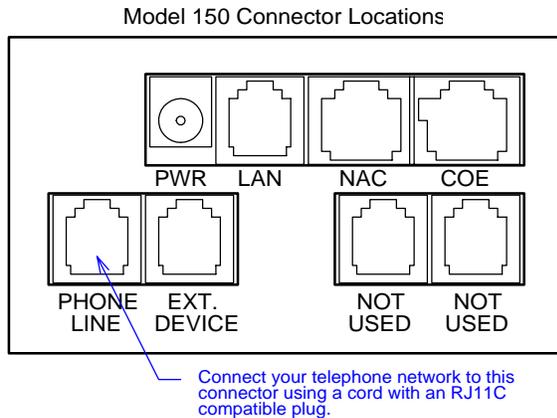

Connect your Model 250 to the telephone network as shown below:

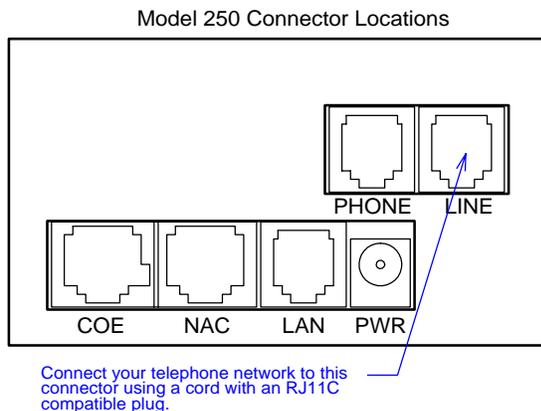

1. Compliance for connection to the telephone network.

- This equipment complies with Part 68 of the FCC rules and the requirements adopted by the ACTA. On the side of this equipment is a label that contains, among other information, a product identifier in the format US:AAAEQ##TXXXX. If requested, this number must be provided to the telephone company.
- This equipment is designed to be connected to the telephone network using a cord set that with an RJ-11C compatible plug that complies with the applicable FCC Part 68 rules and the requirements adopted by the ACTA.

- This equipment has been assigned a Ringer Equivalence Number (or REN). The REN is used to determine the number of devices that may be connected to a telephone line. Excessive RENs on a telephone line may result in the devices not ringing in response to an incoming call. In most but not all areas, the sum of RENs should not exceed five (5.0). To be certain of the number of devices that may be connected to a line, as determined by the total RENs, contact the local telephone company. The REN for this product is part of the product identifier that is printed on the label found on the side of the card reader and has the format US:AAAEQ##TXXXX. The digits represented by ## are the REN without a decimal point (e.g., 03 is a REN of 0.3)
- If this equipment causes harm to the telephone network, the telephone company will notify you in advance that temporary discontinuance of service may be required. But if advance notice isn't practical, the telephone company will notify the customer as soon as possible. Also, you will be advised of your right to file a complaint with the FCC if you believe it is necessary.
- The telephone company may make changes in its facilities, equipment, operations or procedures that could affect the operation of the equipment. If this happens the telephone company will provide advance notice in order for you to make necessary modifications to maintain uninterrupted service.
- This equipment is not intended to be connected to party lines. Connection to party line service is subject to state tariffs. Contact the state public utility commission, public service commission or corporation commission for information.

2. Repair instructions.

- If trouble is experienced with this equipment, please contact Forward Research, Inc., for repair or warranty information. If the equipment is causing harm to the telephone network, the telephone company may request that you disconnect the equipment until the problem is resolved. You can contact the Forward Research, Inc. service department at 952-941-8188.
- This equipment is not user-repairable.

3. Use with alarm equipment.

- If your home or business has specially wired alarm equipment connected to the telephone line, ensure the installation of the Model 150 or Model 250 does not disable your alarm equipment. If you have questions about what will disable alarm equipment, consult your telephone company or qualified installer.